



### DIN 69146 Form A

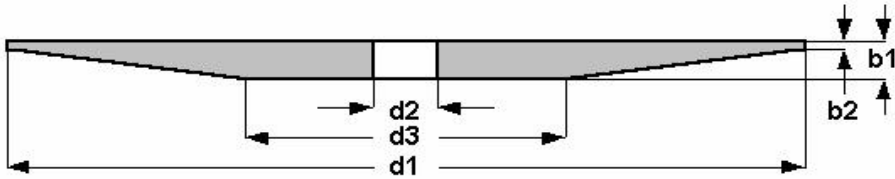


	d 1	b 1	d 2	b 2	d 3
A80	80	5	13 (20)	1	40 (30)
A100	100	6	20	1,5	50
A125	125	7	32 (20)	2	63 (68)
A150	150	8	32 (20)	2	75 (82)
A175	175	10	20	3	85 (95)
A200	200	13 (12)	32	3	100 (95)
A250	250	14	32	3	125

### DIN 69149 Form B

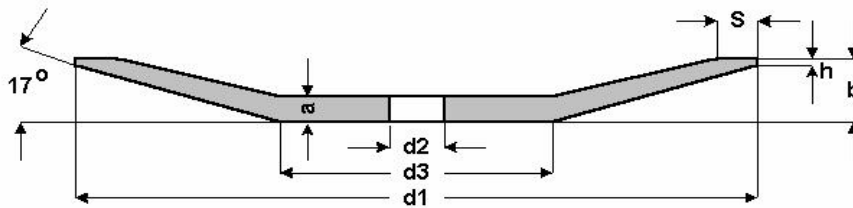


d 1	b	d 2	a	h	s	d 3 = d 4
80	10 (8)	13 (20)	6	2,5 (2)	4	31 (30)
100	13 (12)	20	7	3,2 (3)	5 (6)	36 (35)
125	13 (14)	32 (20)	7	3,2 (3)	6	61 (40)
150	16 (15)	32 (20)	9 (10)	3,2 (3)	8 (7)	66 (50)
175	18	20	11	3	8	60
200	20 (19)	32	12	3,2 (3)	10	90 (70)
250	21	32	14	3	12	100

### DIN 69149 Form BH

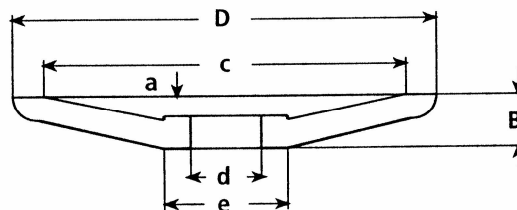


	d 1	b 1	d 2	b 2	d 3	e 3
BH200	200	25	32	13	184	60

### DIN 69147 Form C

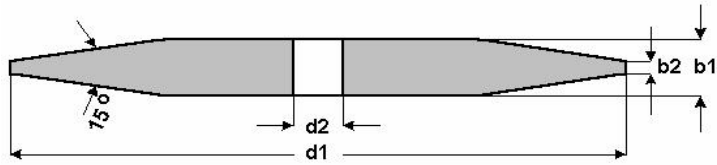


	d 1	b 1	d 2	b 2
<b>C80</b>	<b>80</b>	<b>8</b>	<b>13 (20)</b>	<b>2</b>
<b>C100</b>	<b>100</b>	<b>9</b>	<b>20</b>	<b>2</b>
<b>C125</b>	<b>125</b>	<b>10</b>	<b>32 (20)</b>	<b>2</b>
<b>C150</b>	<b>150</b>	<b>12</b>	<b>32 (20)</b>	<b>2</b>
<b>C175</b>	<b>175</b>	<b>14</b>	<b>32 (20)</b>	<b>3</b>
<b>C200</b>	<b>200</b>	<b>16</b>	<b>32</b>	<b>3</b>
<b>C250</b>	<b>250</b>	<b>19</b>	<b>32</b>	<b>4</b>

### DIN 69139 Form D

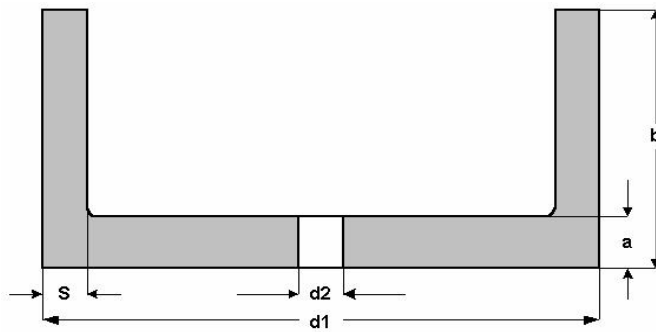

	d 1	b	d 2	s	a
<b>D50</b>	<b>50</b>	<b>32</b>	<b>13</b>	<b>5 (3)</b>	<b>8 (6)</b>
<b>D80</b>	<b>80</b>	<b>40</b>	<b>13 (20)</b>	<b>6 (4)</b>	<b>10 (8)</b>
<b>D100</b>	<b>100</b>	<b>50</b>	<b>20</b>	<b>8 (5)</b>	<b>10</b>
<b>D125</b>	<b>125</b>	<b>63</b>	<b>32 (20)</b>	<b>8 (7' 5)</b>	<b>13 (12)</b>
<b>D150</b>	<b>150</b>	<b>80</b>	<b>32 (20)</b>	<b>10</b>	<b>16</b>

### DIN 69148 Form E

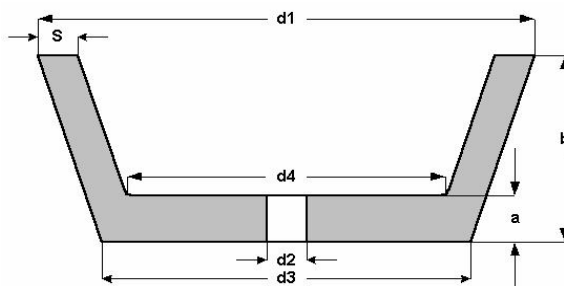

d 1	b	d 2	d 3	d 4	a	s
<b>50</b>	<b>32 (25)</b>	<b>13</b>	<b>27 (32)</b>	<b>22 (25)</b>	<b>8 (6)</b>	<b>4</b>
<b>80</b>	<b>32</b>	<b>13 (20)</b>	<b>57 (55)</b>	<b>46 (48)</b>	<b>8</b>	<b>6 (5)</b>
<b>100</b>	<b>40 (35)</b>	<b>20</b>	<b>71 (75)</b>	<b>56 (65)</b>	<b>10</b>	<b>8 (6)</b>
<b>125</b>	<b>40 (45)</b>	<b>32 (20)</b>	<b>96 (92)</b>	<b>81 (80)</b>	<b>10 (12)</b>	<b>8 (7)</b>
<b>150</b>	<b>50</b>	<b>32 (20)</b>	<b>114</b>	<b>96 (100)</b>	<b>13 (12)</b>	<b>10 (7)</b>